FRIENDSHIP FARM Kennedyville, Maryland (ca 1880)

Constructed in great numbers on the Eastern Shore during the last quarter of the 19th century, "central gable" houses like this building are typified by bracketed or gingerbread cornices, decorative attic windows, and wide front porches. Almost always there is a central entrance and main stair as well as a rear ell. The unusually wide central gable of Friendship Farm House increases its scale and presence.

MARYLAND HISTORICAL TRUST

к **-** 370 MAGI # 1503705635

INVENTORY FORM FOR STATE HISTORIC SITES SURVEY

1 NAME				
HISTORIC	FRIENDSHIP FARMS			
AND/OR COMMON			<u> </u>	
2 LOCATION	South side Morgne	c Road, near cor	ner of	
STREET & NUMBER	Browntown-New Har	lst		
CITY, TOWN Ken	CITY, TOWN Kennedyville VICINITY OF		congressional district Kent	
STATE Marylan	đ		COUNTY	
3 CLASSIFIC	CATION			
CATEGORY	OWNERSHIP	STATUS	PRES	ENT USE
DISTRICT X_BUILDING(S)STRUCTURESITEOBJECT	PUBLICXPRIVATEBOTHUBLIC ACQUISITIONIN PROCESSBEING CONSIDERED	XOCCUPIED _UNOCCUPIED _WORK IN PROGRESS ACCESSIBLE _YES: RESTRICTED _YES: UNRESTRICTED X_NO	XAGRICULTURE —COMMERCIAL —EDUCATIONAL —ENTERTAINMENT —GOVERNMENT —INDUSTRIAL —MILITARY	MUSEUMPARK _XPRIVATE RESIDENCRELIGIOUSSCIENTIFICTRANSPORTATIONOTHER
	F PROPERTY ship Farms c/o Amos St	coltzfus	Telephone #: 34	18–5765
	Box 211		CTATE P	in godo
CITY, TOWN Kenne	dyville	VICINITY OF	Maryland 21620	ip code
5 LOCATION COURTHOUSE. REGISTRY OF DEEDS, STREET & NUMBER	N OF LEGAL DESCR		Liber #: EHP 6 Folio #: 838	64
CITY, TOWN Ch	estertown, Md. 21620		STATE	
6 REPRESEN	NTATION IN EXIST	ING SURVEYS		
DATE		FEDERAL	_STATE _COUNTY _LOCAL	
DEPOSITORY FOR SURVEY RECORDS				
CITY, TOWN			STATE	

CONDITION

CHECK ONE

CHECK ONE

__EXCELLENT
_XGOOD

__FAIR

__DETERIORATED
__RUINS
__UNEXPOSED

__UNALTERED X_ALTERED

XORIGINAL SITE
__MOVED DATE_____

DESCRIBE THE PRESENT AND ORIGINAL (IF KNOWN) PHYSICAL APPEARANCE

Friendship Farm House is a frame structure of the late 19th Century. It is a five bay, central-gable type house with a central entry leading to the main stair hall. The central gable of this building is wider than that of most buildings of this type; in this case it covers over three bays.

The gable roof of the main house is covered with tin roofing and finished with bracketted eaves; there is a cyma recta molding at the roof's edge and a turned finial atop the central gable. Brick chimneys with simple corbelled caps are located in each gable.

Windows throughout the house have two over two sash with a wide central muntin and unmolded trim; sills are also plain and project slightly from the surface of the wall. Louvered shutters, painted black, are in place at most second floor windows. On the first floor, shutters have two panels with a WP-163 type panel moldings. Original hardware--hinges, sliding bolts, and shell-pattern shutter dogs--remain in place.

A pointed window is used in the central gable; there are fourpane windows in the side gables of the main house.

The main entrance of Friendship Farm house has a five-pane overlight and three-pane side-light, both glazed with red and blue glass. The door has four panels, the upper two being round-headed; door and side-light panels have bolection moldings.

8 SIGNIFICANCE

K-370

PERIOD	AF	REAS OF SIGNIFICANCE CH	IECK AND JUSTIFY BELOW		
—PREHISTORIC —1400-1499 —1500-1599 —1600-1699 —1700-1799 —1800-1899 —1900-	_ARCHEOLOGY-PREHISTORIC _ARCHEOLOGY-HISTORIC _AGRICULTURE _XARCHITECTURE _ART _COMMERCE _COMMUNICATIONS	COMMUNITY PLANNING CONSERVATION ECONOMICS EDUCATION ENGINEERING EXPLORATION/SETTLEMENT INDUSTRY INVENTION	LANDSCAPE ARCHITECTURE LAW LITERATURE MILITARY MUSIC PHILOSOPHY POLITICS/GOVERNMENT	RELIGION SCIENCE SCULPTURE SOCIAL/HUMANITARIAN THEATER TRANSPORTATION OTHER (SPECIFY)	
SPECIFIC DATES ca 1880 BUILDER/ARCHITECT					

STATEMENT OF SIGNIFICANCE

Friendship Farm House exemplifies a common type of farmhouse of the period from ca 1875 to ca 1890. Its most significant architectual feature, the central gable of its main facade, is modified to extend over the central three bays instead of the more usual one-and-one-half bays. This modification gives the building an increased scale and presence which is unusual in a house of this size and age. In other ways detailing, floor plan, size, the building is a typical, fairly well preserved example of its type.

The 1877 Atlas of Kent County shows that this building was not yet constructed. Two very similiar houses at Cloverleaf Farm (K-375) and Partnership Farm (K-383) nearby were standing by 1877 and this building was probably constructed soon thereafter.

9 MAJOR BIBLIOGRAPHICAL REFERENCES

Lake, Griffing, & Stevenson. An <u>Illustrated Atlas of Kent and Queen</u>
Anne (sic) Counties, Md. (Philadelphia: 27 South Sixth Street, 1877.)

CONTINUE ON SEPARATE SHEET IF NECESSARY

	PHICAL DATA DMINATED PROPERTY			
			-	
VERBAL BOL	INDARY DESCRIPTION			
			+ a	
LIST AL	L STATES AND COUNTIES FOR PI	ROPERTIES OVERLAPPING	STATE OR COUNTY BOUNDAR	RIES
STATE		COUNTY		
STATE		COUNTY		
11 FORM P	REPARED BY			
NAME / TITLE	Marsha L. Fritz, Surve	ey Consultant	_	
ORGANIZATION	Kent County Planning Co	ommission	778-4600 ext. 6	7
STREET & NUMBE	Court House		TELEPHONE	
CITY OR TOWN	Chestertown, Md. 21620)	STATE	

The Maryland Historic Sites Inventory was officially created by an Act of the Maryland Legislature, to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 Supplement.

The Survey and Inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.


RETURN TO: Maryland Historical Trust
The Shaw House, 21 State Circle
Annapolis, Maryland 21401
(301) 267-1438


The house has a two-story, gable roofed rear wing, extended by a shed roof rear addition. Windows in the wing have six over six sash. There is a simple side porch. Besides the additions previously mentioned, alterations in the building include modification of the floor plan of the wing and the covering of the wooden siding with grey asbestous siding.

The central hall main house has two rooms per floor. The stair is of the dog-leg type with an octagonal walnut newel and handrail and turned oak balusters. Ogee type moldings are used to finish the seven-inch baseboards, as the panel moldings of the four-panel doors, and as a part of the window and door trim as shown.

Painted oak graining remains on the baseboards, door, and the stair risers. In the western bedroom a printed cabbage-rose wall paper cornice is used above red-painted walls. Although this is not the original wall treatment, it appears to be an early one.

There are no fireplaces in the house, although mantle shelves were hung on the chimney breasts where stoves were installed.

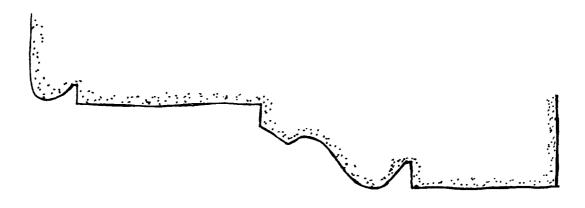

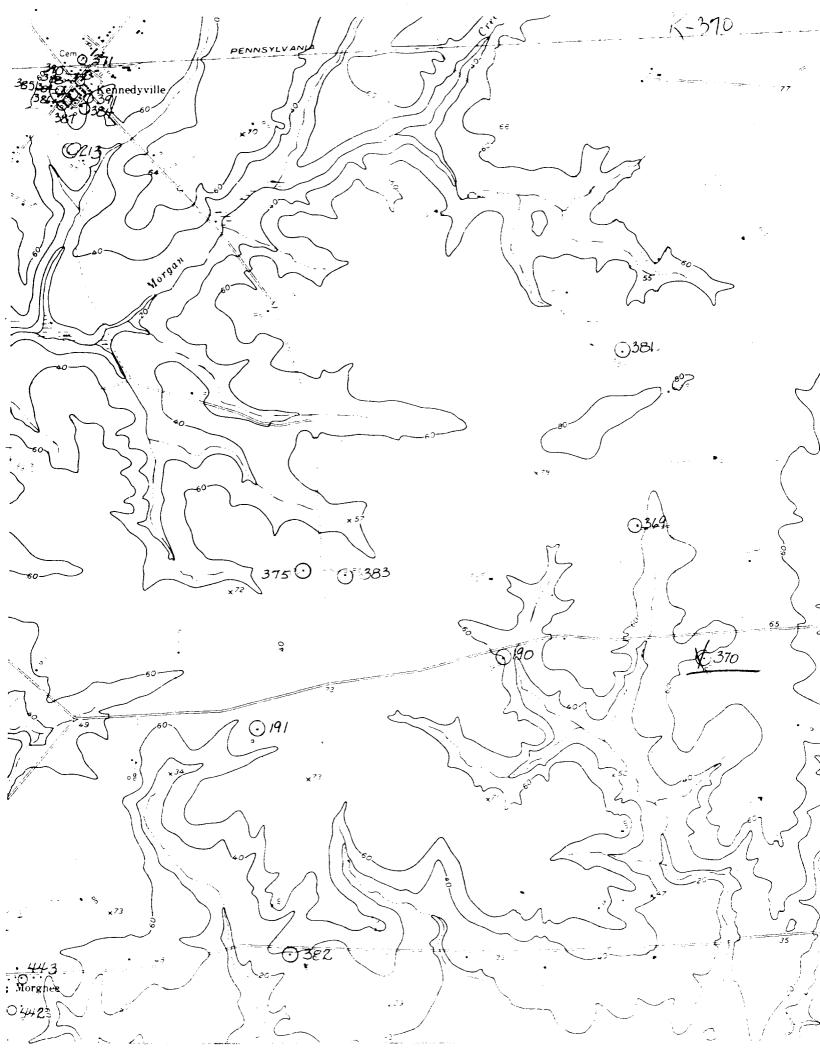



K-370 Friendship Farm toose North Facabe Kennedyville Kent County M.L. Fritz 11/1979